

### Staff Report

To: BOZAR

From: Jessie Earley, Town Planner III

Meeting Date: DRC, February 1, 2025

RE: Liebl (226 Sopris Avenue), Secondary Review

**PROJECT TITLE:** Liebl (226 Sopris Avenue)

<u>SUMMARY:</u> Consideration of the application of **Denise Liebl and Todd Liebl** to site an addition at the existing contributing historic primary building and accessory building and to site a new cold accessory building to be located at 226 Sopris Avenue, the west 75 feet of lots 1 to 5, both inclusive, except the west 12.5 feet thereof, Block 33 in the R1C zone. (Jose)

- Architectural approval is required.

**LEGAL DESCRIPTION:** the west 75 feet of lots 1 to 5, both inclusive, except the west 12.5 feet

thereof, Block 33

**ADDRESS:** 226 Sopris Avenue

**ZONE DISTRICT:** R1C

**OWNER:** Denise Liebl and Todd Liebl

**APPLICANT:** Anna Rhees and Jim Jose, SHM Architects

**DRC MEMBERS:** Alvarez Marti and Anderson – 1/21/2025 DRC; Davol and Staab (2/10/2025)

STAFF MEMBER: Jessie Earley, Planner III

### **ATTACHMENTS:**

- 1. Plans
- 2. Photos
- 3. DRC notes 1/21/2025
- 4. GIS Map
- 5. Materials lists
- 6. Materials narrative
- 7. Rehabilitation narrative
- 8. Letter from adjacent property owner
- 9. Historic building survey
- 10. Section 16-4-460 16-4-520 (R1C)

These packet materials are available at this <u>link</u>. Staff can provide paper copies of the packet upon request.

#### PROJECT DESCRIPTION

- 1. Site an addition to the southeast corner of the existing historic single-family residence.
- 2. Lift and place the existing historic accessory building on a new foundation.
- 3. Site an addition to the existing historic accessory building.
- 4. Site a new cold accessory building





# **PUBLIC NOTICE**

This item was properly noticed per Section 16-22-110 (c). The affidavit of posting is on file in the Preservation Department.

I. <u>Background/Overview</u>: Anna Rhees and Jim Jose of SHM Architects submitted an application on behalf of the Liebl's for siting an addition to the existing contributing historic primary building, lifting and shifting the existing accessory building to the north, siting an addition on the existing historic accessory building and siting a new cold accessory building. The two existing buildings are classified as contributing to the National Historic District.





<u>II.</u> <u>Status</u>: The applicants met with the DRC at the 2/10 meeting. Notes are attached for more detailed information.

The following revisions have been made to the plans since that meeting:

- 18" metal foundation cover added to the addition on the existing accessory building
- 18" metal foundation cover added to the new accessory building
- Slight variation in color to addition on the existing accessory and new accessory building
- Added to site plan:
  - o Walkways/patios
  - Parking substrate
  - Revegetation for disturbed areas
  - Drainage arrows
- Existing and proposed lighting added to plans.
- 3D rendering provided for proposed addition to primary building.
- Window removed from south elevation of new accessory building.
- Elevations updated on new accessory building.
- Details added garage doors.

III. Context: Refer to guidelines 4.25-4.26. The two-story, rectangular frame dwelling with hipped roof with widely overhanging eaves is situated in the historic R1C zone with the R1C zone across the street to the north. Across the alley to the south, the R2C zone is located. The neighborhood contains a mix of small 1 ½ story and two-story homes, many of which are historic with either contributing or non-contributing status. Historically, these areas were primarily residential and still remain this way today.



The Board will need to determine whether the additions will appear congruent or dissimilar with the surrounding neighborhood context per GL 4.26.

GL	Staff Analysis	DRC Recommendation
4.25 Excessive similarity	No conflict.	Support
4.26 Excessive dissimilarity	Discussion is encouraged to determine if the proposed additions are acceptable or if they will appear excessively dissimilar.	Support
	Staff encourages discussion about the materials as proposed for the addition to the existing accessory building and the new accessory building, as they do not properly cleave the difference between the existing historic structure and new addition.	1/21 DRC: Members voiced that a small distinction would be good, but it should not be too different, as the nature of the buildings are simplicity. A slight differentiation has been provided.
	Staff finds that the windows, as proposed for the existing accessory building are dissimilar due to the window to wall ratio, as proposed on the west.	Full Board discussion.
	Staff finds that the rehabilitation plan may not be consistent with National Park Service standards and should be walked through to ensure that all historic materials will remain.	Discuss onsite and with full Board.







1/21/2025 DRC rendering from South




2/10/2025 DRC: revised south rendering

# III. Historic Background:


The property contains two contributing historic structures. Both buildings are protected by the National Historic District and the local historic district being the Town of Crested Butte original plat. See the attached historic building survey for more detailed information.



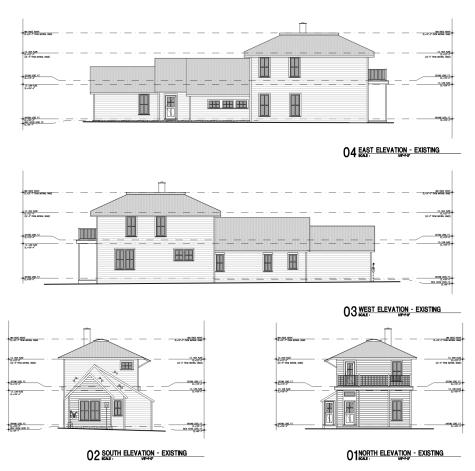

As built drawings from the application



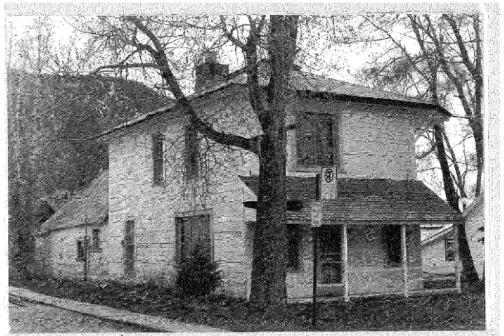

North elevation from HBS



Historic photo of north side of home









North elevation post remodel





Southeast elevation from HBS



Southeast elevation existing



**Primary Building:** This house was built in 1883. This is a two-story rectangular frame dwelling with a hipped roof with widely overhanging eaves and rear gabled extensions. The building has corrugated metal roofing. The eaves on the east have braces beneath. There is a concrete block chimney with clay flue cap on the west roof slope and a concrete foundation. The walls are clad with beadboard applied horizontally. The upper story front had two square engaged pilasters at corners, as seen in the photos above. These were revised when the remodel was done. There is now a door and a window. There are large, two light windows on the upper story with wood surrounds with sills that extend beyond jambs. There was a full length shed roof porch in photos above that were converted to a second story deck due to photographic evidence of the building historically with the feature. There are square post supports and a horizontal board balustrade. There is a slightly off-center entrance with paneled and glazed door. There are two over two light double hung sash windows with plain wood surrounds for the flank door. The east side has two, two over two light windows on each story. The west side has two, two over two light windows on the upper story and one large three light window and single two over two light windows on the lower. There are two gabled projections on the rear. The middle section has a brick chimney and shed projection on the east with a door with two rounded arched lights on the north and band of six light windows on the east.

The extent of alterations on this home were:

- <u>2003</u>: Reconstruct front of house per 1920's photo
- Addition of 6' on south portion of building
- Window addition on east side
- Two skylights on east elevation

This home is associated with the Martin Verzuh family. Martin came from Austria-Croatia and married Frances Spehar in 1897. Martin operated a saloon and opened a general mercantile in Crested Butted in 1905. The couple had eight children who were educated in Crested Butte schools during 1924-1936.

This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double hung sash windows and paneled and glazed doors.


Accessory Building: This building was built in the 1890's. It is a one story, rectangular (12'x18') frame shed with front gable roof and overhanging eaves. The building has metal roofing. The walls are clad with vertical board siding. On the north are double hinged vertical board doors. The windows have been covered with plywood.

The extent of alterations on this building are:

- Windows were covered with plywood.
- Wall patched with horizontal boards on the east.

This building is representative of the outbuildings erected in Crested Butte. Features include the gable roof, frame construction and vertical board siding.



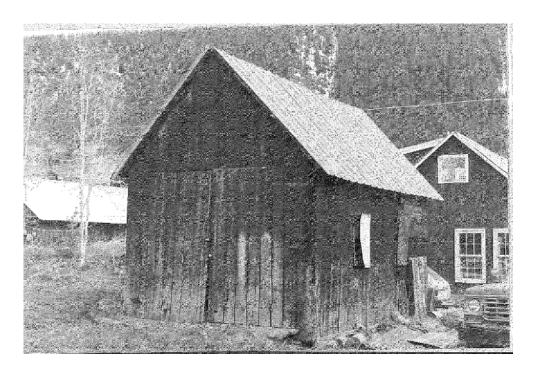

South elevation of accessory building from HBS



South elevation of accessory building from HBS





North elevation of accessory building – existing

# <u>I.</u>

# <u>Land Use Code Review:</u> a. Historic Residential Zone (R1C) (Sec. 16-4-460 – 16-4-520)

Dimensional	Required by Chapter 16	Proposed	Compliant
Limitations			
Minimum Lot Width:	25'	50'	Yes
Maximum Lot Area:	9375 sf	7812.5 sf	Yes
Minimum Lot Area:	3750 sf	7812.5 sf0	Yes
# Dwellings:		1	Yes
Minimum Setbacks:			
Principal: Front:	20'	4' (existing, no change)	Yes
Principal: Side Yard (West):	Seven and one-half (7½) feet for single-story and flat-roofed buildings, and as much as eleven and one- half (11½) feet for sloped- roofed buildings, dependent upon snow storage guidelines.	11'3" (existing) 7'6" (addition to existing AB)	Yes




Principal: Side Yard (East):	Seven and one-half (7½)	24'11" (existing)	Yes
	feet for single-story and flat-roofed buildings, and	32'3" (proposed addition)	
	as much as eleven and one- half (11½) feet for sloped-		
	roofed buildings, dependent		
	upon snow storage guidelines.		
Principal: Rear Yard (South)	10' (Principal)	10'11" (existing AB)	Yes
Accessory Building (existing): Side Yard (West):	Seven and one-half (7½) feet for single-story and flat-roofed buildings, and as much as eleven and one-half (11½) feet for sloped-roofed buildings, dependent upon snow storage	14'8" (existing) See above for proposed, due to inclusion with primary.	Yes
Accessory Building	guidelines. Seven and one-half (7½)	34'4" (existing)	Yes
(existing): Side Yard (East):		See above for proposed, due to inclusion with primary.	ies
	half (11½) feet for sloped- roofed buildings, dependent upon snow storage		
A D-: ! 1 !:	guidelines. 5' (Accessory)	6'11" (oxisting)	V
Accessory Building (existing): Rear:	10 (Principal)	6'11" (existing) See above for proposed, due to inclusion with primary.	Yes
Accessory Building (new): Side Yard (West):	Seven and one-half (7½) feet for single-story and flat-roofed buildings, and as much as eleven and one-half (11½) feet for sloped-roofed buildings, dependent upon snow storage guidelines.	10'	Yes
Accessory Building: Side Yard (East):	Seven and one-half (7½) feet for single-story and flat-roofed buildings, and as much as eleven and one-half (11½) feet for sloped-roofed buildings, dependent upon snow storage guidelines.	10'3" (proposed)	Yes
Accessory Building: Rear:	5' (Accessory) 10' (Principal)	5' (proposed)	Yes
Between buildings (wall to wall)	10'	The existing accessory will be shifted 5' to the north and will be closer than 10'. This building will be incorporated into the overall sf for the primary building for the sake of FAR.	Yes
		12'4" (proposed AB to primary)	Yes
		10' (proposed AB to existing AB)	Yes




Max FAR – Primary building	0.3-0.32	0.3, (2273 primary +116 AB = 2389/7812.5 sf) - existing 0.318, (2487.2 sf/7812.5 sf)	Yes
Max FAR – All Buildings:	0.48	0.363, 2837.2 sf (2487.2 sf primary and existing AB + 350.08 sf accessory) - proposed	Yes
Height:	30'	25'3" (principal, existing/proposed) 15'9" (existing accessory, existing) 15'11" (existing accessory, proposed) 14'7" (new accessory, proposed)	Yes
Roof Pitch	Minimum 4:12	6:12 (principal, existing hipped roofs)  12:12 (gabled roofs rear, existing)  12:12 (proposed addition)  7:12 (pitch break on south, existing)  12:12 (existing accessory, existing gable)  4:12 (existing accessory, proposed shed roof pitch break)  8:12 (proposed accessory, gabled roofs)	Yes
Snow Storage	>33%	44.6%	Yes
Parking	2 spaces	2 spaces (1 interior, 1 exterior)	Yes
Open Space	50%	70.1 %	Yes



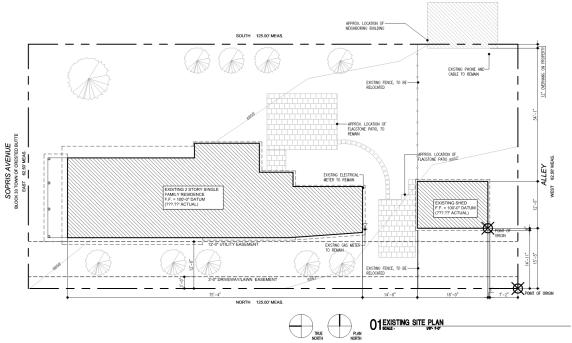


Existing Site Plan

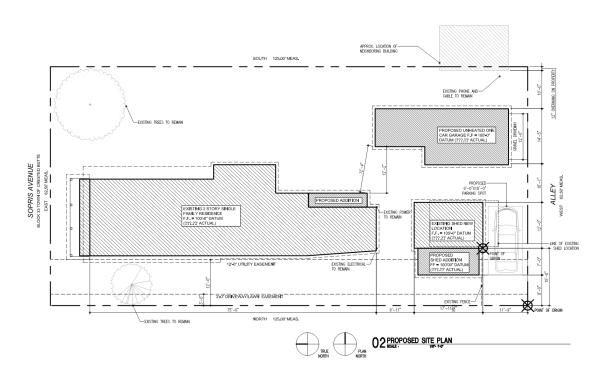

1/21 DRC: Proposed Site Plan



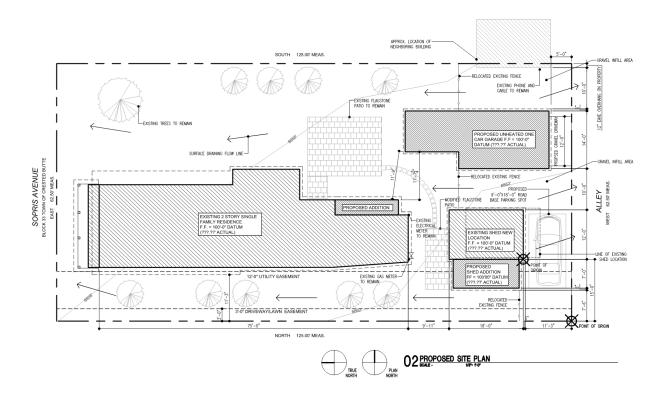

# 2/10 DRC Revised Site Plan

# **II.** Design GL Analysis

### **Purpose for the R1C District:**

The purpose of the R1C district is to provide areas for more intensive residential development than allowed in the R1 District, along with customary accessory uses. It is imperative to carefully monitor such development so that it blends into its neighborhood context and the scale and fabric of the Town, paying particular attention to the characteristics, size and scale of existing historic buildings.

### Design goals for the R1C district include:

- To encourage appropriate infill and changes to existing structures and preserve the historic residential character of the
- To place importance on the appropriate development of the entire property not just individual structures.

# b. **Site planning:** Refer to GL: 2.16-2.40, 3.1-3.2.

GL	Staff Analysis	DRC Recommendation
Topography	Topography is not included, but should	Add information to the plans
	be. This information is not anticipated	
	to impact FAR or height requirement.	
2.8 Drainage	Drainage arrows have been shown and	Add information to the plans, which has
_	show drainage to the north and south	been provided.
	to the alley.	



Easements  2.16 Substantial landscaping	There area existing easements on the west portion of the lot, which includes a 3' driveway easement and 12' utility easement. There is a letter from the property owner to the east expressing support for the addition.  The plan is fairly minimal. Provision of	Support with neighbor support.
	a final landscape plan will be required if there are revisions after permitting.	
2.18/3.1 Preservation of existing mature trees	There are existing trees on the north portion of the lot, which are to remain and will not be impacted by the additions. The applicant has added the existing trees to the lot and no trees will be removed.	Confirm number of trees, which has been provided.
2.19 New trees	There are no new trees noted on the plans.	
2.16 a./ 2.20 Native plantings	Ground cover for disturbed areas has been noted as grass. Native plantings are encouraged by the GL.	Add information to plans, which has been provided.
2.16 e Pervious materials	The existing flagstone patios and walkways are to remain.  Parking has been included on the proposed site plan as gravel.	Add information to plans, which has been provided.
2.28 e & f Parking substrate	Parking spaces are noted on the site plan. Substrate is called out as gravel.	Add information to plans, which has been provided.
(2.37-2.40)/ 16-17-40 Exterior Lighting	Existing and proposed lighting has been included. They appear to meet the intents of the requirements.  If existing fixtures do not meet requirements, they will be required to be upgraded as part of the work to be done.	Add information to plans, which has been provided.
Solar	NA	NA
Utilities	Existing and proposed wet and dry utilities must be noted on the plan.  Rights of way (alley and Sopris Avenue) must be shown to scale on the site plans.	Add information to the plans.
2.7 Snow Storage	Snow storage has been depicted on the plan and corresponds to the areas to be plowed.	Support
2.27 Fences	An existing fence is on the south. Confirmation is needed if there will be a new fence proposed.	

c. **Rehabilitation Plan**: Refer to GL 3.2, 3.5-3.16. A narrative from the applicant has been provided to outline rehabilitation methods for the accessory building. The primary building will only have a small addition. The remainder of the building will remain the same. Certain details below appear to conflict with methods of preservation encouraged



in Chapter 3 of the Design Standards and Guidelines. An onsite meeting with the architect, owners, contractor, staff and Board members will be required prior to permitting to discuss the methods of preservation.

Notes from plans indicate:

- The accessory building will be lifted and shifted 15' to the east temporarily.
- Then, a new foundation will be installed 5' to the north of existing accessory location.
- Shift the building to the new foundation with a small addition to the west.
- All existing framing will remain in place and new framing will be added from the interior.
- Vertical board on board siding to remain.
- Existing two windows are proposed for replacement.
- Existing exposed rafter tails to remain.
- Existing corrugated metal roofing to be replaced with rusted standing seam roofing.
- Existing trim details to remain.
- Existing barn style doors on north to remain and be rehabilitated.

GL	Staff Analysis	DRC Recommendation
3.2 Original footprint	The accessory building does not currently have a foundation and must be sited on a foundation. The property owners would like to shift the building 5' back to accommodate a parking space. Support.  The primary building is to remain. Support.	Support
3.8 Historic materials	The applicants propose removal of the windows, as described above. All historic windows must remain and be rehabilitated.	

# d. Alterations to the historic building: Refer to GL 3.12, 3.14, 3.22-3.24

As outlined above, there have been some alterations to this historic building.

GL	Staff Analysis	DRC Recommendation
3.22 b	This GL speaks to alterations to historic buildings. The alterations to this accessory building have been very minor.	

#### e. New windows: Refer to GL 3.22-3.24; 3.49-3.54.



3.49 Historic windows	All historic windows must remain and be rehabilitated.	Discuss at site visit.
3.50 Position of historic windows	Windows on the historic portion of the building are to be remain in existing openings. Support.	Support

# f. Addition - Mass, scale and form: Refer to GL 3.17-3.19, 3.36, 5.114

GL	Staff Analysis	DRC Recommendation
3.17 Additions to historic buildings	Primary: The addition to the primary building fills in a small area on the southeast corner. A 3D rendering showing the existing and proposed area would be helpful to show the change. The proposed renderings have been provided.  Accessory: The addition to the accessory building steps down from the main ridge and also from the north and south. A change in material would be encouraged.	Support
3.18 a Stepping down additions	Primary: The addition will continue the roof pitch that is existing in the southwest corner of the building 12:12.  Accessory: The addition on the west steps down 4'3" from the main ridge. Discussion is encouraged to determine if the addition is subordinate.	Support
3.18 b/ 3.36 Connecter	This GL suggests a connector. In both the case of the accessory building and primary building Staff does not feel that a connector would be warranted.	Support without the connector.
3.18 c Mass	Primary: The size of the addition (110 sf) is much smaller than the size of the original structure (2273 sf) per GL 3.18 c. The mass of the addition will be placed on the rear, but as noted a 3D model of the addition would be of help.  Accessory: The existing AB is 216 sf and the addition is 111 sf, which is	Support
3.19/ 3.37 Additions as products of their	Staff feels that neither addition appears large in comparison with the existing structure and other structures in the surrounding R1C zone district and the proposed plans match scale of the surrounding buildings within the zone.  Primary: The addition is proposed to	Support
own time	match the existing primary building, which is appropriate given the size.	Sapport



	Support.	
	Accessory: The addition to the existing AB is proposed to match. The additions should have siding proposed that should be distinguishable from the existing historic building.	· ·
3.21 Traditional entrance pattern	The existing entry will remain.	Support



# Plan view (east) - Primary Building - existing



Plan view (east)-Primary Building - proposed






02 SOUTH ELEVATION - EXISTING

# Plan view (south) - Primary Building - existing



Plan view (south) - Primary Building - proposed



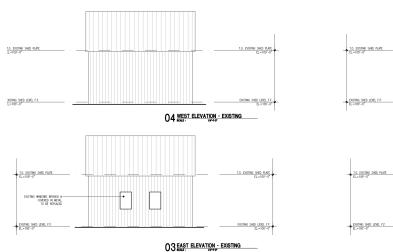

15. DOTRO SED FAST

16. DOTRO SED FAST

16. DOTRO SED FAST

17. DOTRO SED FAST

16. DOTRO SED FAST

17. DOTRO SED FAST

17. DOTRO SED FAST

18. DOTRO SED FAST

18. DOTRO SED FAST


18. DOTRO SED FAST

19. DOTRO SED FAST

19. DOTRO SED FAST

10. DO

Plan view -Accessory Building - existing

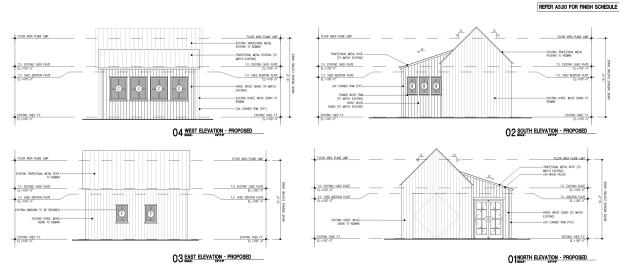

Plan view - Accessory Building - proposed

# g. **Design and Style:** Refer to GL 3.19, 3.39, 4.32-4.39.

GL	Staff Analysis	DRC Recommendation
3.39/4.39 Compatibility of addition/Roof	<b>Primary</b> : The existing roof is a hipped	Support
forms	roof transitioning down to two gable and	
	a shed on the side and the addition will	
	continue the gable roof, which meets the	
	intents of this GL.	



	Staff does not feel that a connector module is warranted for the addition to the primary building.	
	Accessory: The existing roof is gabled and this will add a shed roof to the west side, which steps back from the existing building, as seen from the alley on the south and north. Support.	Support
4.32 – 4.34 Forms of additions	Discussion is encouraged as to whether the design of the addition cleaves a relationship with the architectural style of the residence and accessory building and relates with the overall styles within the neighborhood or appears incongruent.	Support

# **h. Roof forms:** Refer to guidelines \*3.36, 3.39, 4.41-4.45.

GL	Staff Analysis	DRC Recommendation
3.39/4.45 Roof forms	The existing primary building has a 6:12	Support
	hipped roof pitch and 12:12 gables and	
	the proposed addition will incorporate a	
	12:12 gable, which meets the intents of	
	GL 4.45 a.	
	The accessory building has a gable	Support
	which is 12:12 pitch and the addition	
	proposes a 4:12, which is within the	
	allowed pitches. Support.	
4.42 Secondary roofs	GL 4.42 allows for shed roof pitches	Support
	when secondary, which is as proposed	
	for the accessory building.	
4.44 Ridge lines	There will be no change to the existing	Support
	roof lines.	

# i. **Porches/balconies/decks:** Refer to guidelines 3.47-3.48; 4.49-4.52.

GL	Staff Analysis	DRC Recommendation	
3.47 Preserve existing porches	The existing front deck and porch are to	Support	
	remain.		
3.48 Porch	NA	NA	

# **j.** Windows: Refer to Guidelines 3.40, 4.53-4.63.




GL	Staff Analysis	DRC Recommendation
3.40 Primary elevation	Existing windows on the primary	Support
	elevation of the primary building are to	
	remain.	
4.53 Window to wall ratio	Existing. Support.	
	East (primary): There is a three pack of horizontal windows and a door to remain. Currently there is one window on the rear module, which is proposed to be revised to a two pack. This two pack would be moved from the south elevation.	Support
	South (primary): There is an existing window on the south elevation on the secondary gable module that would be removed and a two pack of windows on the southernmost gable module that would be replaced with a full light French door.	Support
	South (accessory): There are no existing openings in the south elevation of the AB. Proposed are three single windows for the addition. This is a 7% window to wall ratio, which is relational. The interior window does crowd the inside corner.	Support
	North (accessory): There is an existing barn door on this elevation which will remain. On the addition, there is a full light French door proposed.	Support
	East (accessory): There are two existing historic windows on this elevation, which must remain and be rehabilitated.	Discuss windows at site visit and with Full Board.
	West (accessory): There are no existing openings and four single windows are proposed. These four openings propose 48 sf of opening for 147 sf of wall space, which is 32% of window to wall. This is excessive. This is not a front façade, but it does not appear as it would have historically.	1/21 DRC: Members thought that the window to wall as proposed exceeds ratios seen historically small simple accessory buildings.
4.54 Vertical emphasis	Windows are shown as a two over two double hung style window to match existing windows.	Support
	A window and door schedule has been provided.	
	Casement windows are noted. Per GL	



	4.54, these windows are reserved on historic buildings for egress only. Non-egress windows should be double hung windows. All windows must provide simulated divided light for new windows.	
4.56 Window material	Aluminum clad windows are noted on the materials list, color confirmation needed.  Primary: If all windows exist as wood, they would need to remain as wood. Simulated divided lights are required, which are noted on the materials list.  Accessory: All windows exist as wood in the AB and any new windows must be wood.	Windows must be wood on the existing historic accessory building.  The new accessory building can incorporate aluminum clad windows.
4.57 Fenestration pattern	Primary: Support  Accessory: Met.	Support
4.58 Groupings of 2 or more windows	Primary: Support  Accessory: There is trim provided between windows on the south and west. These windows cannot be mulled.	Support
4.59 Window and door trim	Trim is proposed as 2"x4". Support.	Support
4.60 Divided lights	Simulated divided lights are required.	Support

	WIN[	NDOW SCHEDULE												
г	WINDO	W		SPECIFICATION					DIVIDED LI	ΓE	COLOR			$\neg$
- [7	ARK	TYPE (+EGRESS)	SIZE (W X H)	MANUFACTURER	MATERIAL	GLASS TYPE	SCREEN	JAMB	PROFILE	SIZE	EXTERIOR	INTERIOR	REMARKS:	MARK
	A	DOUBLE HUNG (+)	5'-4" x 5'-5"	EXISTING									EXISTING TO BE RE-USED	A
	В	DOUBLE HUNG	1'-9" x 3'-0"	T.B.D.	METAL-CLAD WOOD	INSULATED		2"			MATCH EXIST.	MATCH EXIST.		В
	C	DOUBLE HUNG	3'-0" x 4'-0"	T.B.D.	METAL-CLAD WOOD	INSULATED		2"			MATCH EXIST.	MATCH EXIST.		C
П	D	DOUBLE HUNG	2'-0" x 4'-0"	T.B.D.	METAL-CLAD WOOD	INSULATED		2"			MATCH EXIST.	MATCH EXIST.		D
	Ε	DOUBLE HUNG	2'-0" x 3'-0"	T.B.D.	METAL-CLAD WOOD	INSULATED		2"			MATCH EXIST.	MATCH EXIST.		E
	F	DOUBLE HUNG	2'-0" x 3'-0"	T.B.D.	METAL-CLAD WOOD	INSULATED		2"			MATCH EXIST.	MATCH EXIST.		F
П														

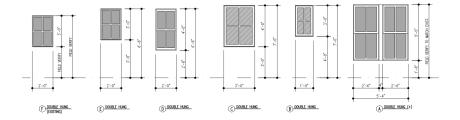

k. **Doors:** Refer to GL 4.64-4.69.




GL	Staff Analysis	DRC Recommendation
4.64 Primary door	The primary door will continue to face Sopris Avenue. Support.	Support
4.65 Primary door	Primary: This door is to remain. Support.	Support
	Accessory: The primary barn style door on the north is to remain and be rehabilitated.	
4.66/3.58 Secondary doors	There are full light, aluminum clad French doors proposed on the south elevation of the primary building. This proposal appears to be consistent with GL 4.66 b.	Support
	There is another set of full light, aluminum clad French doors proposed on the north elevation of the accessory building. This French door is not highly visible from the street but does appear tight on this small module. A single door might appear more in historic context.	





South – proposed rear door (primary building)

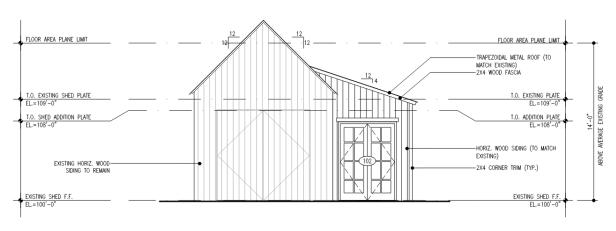

01 NORTH ELEVATION - PROPOSED


North – proposed French door (accessory building)



DOOR NOTES:

- MANUFACTURER TO SUBMIT SHOP DRAWINGS TO THE CONTRACTOR FOR APPROVAL PRIOR TO FABRICAL UNITS MARKED WITH '\*' INDICATE DIMENSIONS THAT NEED TO BE VERIFIED BY THE MANUFACTURER
- STEEL DOORS TO HAVE LOE-JOED INSULATED GLAZING WITH U VALUE OF 129 AND SHIPC OF 12S GLAZING TO HAVE U FACTOR 35 MAX / SHIPC 125 MAX PER ENERGY CODE ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER-STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER STRIPPET ALL DOORS BETWEEN AC SPACES AND NON-AC SPACES TO BE INSULATED AND WEATHER STRIPPET AND THE STRIPPET A
- 7) DOOR AND WINDOW UNITS OF SAME DIMENSION TO ALIGN
  8) ALL VERTICAL DIMENSIONS MEASURED FROM FLOOR DIVISION
- ALL VERTICAL DIMENSIONS MEASURED FROM FLOOR FINISH
   INTERIOR FINISH TO BE COORDINATED WITH INTERIOR DESIGNER
- 12) PROVIDE SOFT-CLOSE HARDWARE AT ALL POCKET DOORS

υv	DOOK SCHEDULE													
D00	R		THICKNESS	SPECIFICATION				DIMDED TI	TE	COLOR		HARDWARE		
NO.	TYPE	SIZE (W X H)	(1 3/4"UNO)	MANUFACTURER	MATERIAL	GLASS TYPE	JAMB	PROFILE	SIZE	EXTERIOR .	INTERIOR	COLOR	REMARKS:	NO.
101	01	5'-0" x 7'-0"	2 1/4"		METAL-CLAD WOOD	INSULATED	4 1/2"			MATCH EXIST.	MATCH EXIST.	MATCH EXIST.		101
102	01	5'-2" x 7'-0"	2 1/4"		METAL-CLAD WOOD	INSULATED	4 1/2"			MATCH EXIST.	MATCH EXIST.	MATCH EXIST.		102
103	02	2'-6" x 7'-0"			WOOD								POCKET	103
104A	03	8'-0" x 8'-0"			ALUMNUM								GARAGE	104A
104B	04	3'-6" x 6'-8"			ALUMNUM								GARAGE	104B
1040	05	3'-0" x 6'-8"	2 1/4"		METAL-CLAD WOOD	INSULATED								1040

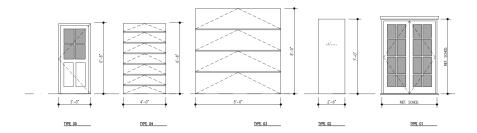

# 1. **Lighting**: Refer to GL 2.37-2.40.

GL	Staff Analysis	DRC Recommendation
2.37 Exterior lighting	Existing and proposed lighting has been included. They appear to meet the intents of the requirements.  If existing fixtures do not meet requirements, they will be required to be upgraded as part of the work to be done.	1

m. Materials: Refer to GL 4.75-4.83.

# **Primary**:



#### Liebl Remodel materials list:

#### Addition to existing house

Roof: Corrugated metal to match existing
Siding: Painted wood clapboards, dimensions and color to match existing
Trim: Painted wood trim, dimensions and color to match existing

Foundation coating: painted stucco to match existing

on to existing shed:

Roof: weathering steel standing seam (existing shed roof to also be replaced with same)

Siding: Vintage woods heat modified southern yellow pine in color 101
Double espress (to match existing shed)

18" wainscot in recycled corrugated from main house roof to addition and also to base of exisiting shed in new location (to conceal new foundation)

Trim: to match siding

New garage:

Roof: weathering steel standing seam
Siding: Vintage woods heat modified southern yellow pine in color 101- Double espresso
(to match existing shed)

18" wainscot in recycled corrugated from main house roof





dimensions and color to match existing

painted wood trim. dimensions and color to match existing house

Weathered corrugated metal is noted to match existing for roofing.

Siding is proposed as horizontal siding to match existing, sizing and color confirmation is needed.

Trim, fascia and corner boards are noted to match existing. Sizing and color confirmation are needed for all.

There will be no new windows. The window from the south will be reused on the east elevation.

There is a new wood French door with divided lights proposed on the south. The door plan states that this door will be a metal clad door. Confirmation of the door materials is needed.

The foundation cover will be a painted stucco to match existing.

### **Accessory Building:**





existing shed





Proposed weathering steel standing seam



Proposed weathering steel standing seam







Proposed Alley view

1/21 DRC: south



2/10 DRC: revised south

Roofing is proposed as weathered steel.

Siding is proposed as vertical board and batten (double espresso) southern yellow pine.



Foundation cover 18" maximum is proposed as recycled corrugated metal from the primary building.

Trim, fascia and corner boards are noted to match existing. Sizing and color confirmation is needed.

The garage door (carriage style) existing will be rehabilitated (north). There is a wood French door proposed on the north elevation with divided lights. The door plan states that this door will be metal clad, confirmation of the materials is needed.

There are two existing windows that must remain. The other proposed windows are noted as aluminum clad.

GL	Staff Analysis	DRC Recommendation
3.6	As stated earlier, all historic materials need to remain and be rehabilitated.	Discuss onsite and with full Board.
	The onsite meeting will help to evaluate	
	these materials and also talk through the	
	methods for preservation.	
4.72 Eaves/overhangs	Met.	Support
4.75 Exterior materials	<u>Primary</u> : Met	1/21 DRC: Members voiced that a small distinction would be good, but it should
	Accessory: The proposed siding meets	not be too different, as the nature of the
	the intents of the GL. However, more	buildings are simplicity. A slight
	definition is needed for the addition to	differentiation has been provided.
	the accessory to help define this historic portion versus the new portion.	
4.79 Paint/stain	The siding and trim are painted which is	Support
l min stand	consistent with the GL.	Support
4.81 Mixing materials	A mix of materials is not proposed at	Support
2.6172.07	this time for either building.	
3.61 Roofing materials	The materials proposed are supported by the GL.	Support
	More discussion is needed to ensure that	Discuss onsite and with full Board.
	the historic material will remain in place.	
	Also, the rusted material has generally	
	not been supported. Naturally weathered	
	material is supported on new portions of the building.	
4.80 a foundation treatment	The proposed 18" of metal is consistent	1/21 DRC: Members felt that this
	with the GL.	proposal helped to show the old versus
		new construction.

# **n.** Accessory building mass/scale/form and placement (garage): Refer to GL 4.84-4.86, 4.89;

The proposed south cold accessory building is an 22'5"x15'2" gabled building with a smaller gable module to the north 13'x10'5". The accessory has a 8:12 pitch. This must be a cold building due to the size, as proposed.



GL	Staff Analysis	DRC Recommendation
4.84 Smaller in size	The proposed building is smaller in	Support
	scale than the primary building, as requested by the GL.	
4.85/5.94 Rear of the site	The proposed building is located at	Support
	the rear (south) of the lot. Support.	
4.86 Vary appearance	As seen in the 3D models, this	Support
	building is proposed to mimic the existing historic building to the west. The form of the building is simple and supported. However, the material should be varied from the building to the west.	1/21 DRC: Members voiced that a small distinction would be good, but it should not be too different, as the nature of the buildings are simplicity. A slight differentiation has been provided.
4.89 d. porches	NA	NA



Proposed Alley view

1/21 DRC: south rendering





2/10: revised south rendering



1/21 DRC: flat plan views

35





10. 100.0 (100.0

02 NORTH ELEVATION - GARAGE


04 WEST ELEVATION - GARAGE

## ORDE ELEVATION - GARAGE

## ORDE ELEVATION - GARAGE

## ORDE ELEVATION - GARAGE

| 10 ORDE ELEVATION - GARAGE
| 10 ORDE ELEVATION - GARAGE
| 10 ORDE ELEVATION - GARAGE
| 10 ORDE ELEVATION - GARAGE
| 10 ORDE ELEVATION - GARAGE
| 10 ORDE ELEVATION - GARAGE
| 10 ORDE ELEVATION - GARAGE
| 10 ORDE ELEVATION - GARAGE
| 10 ORDE ELEVATION - GARAGE

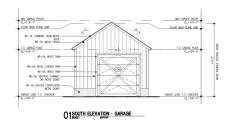

2/10 DRC: revised flat plan views

Addition to existing shed:

Roof: weathering steel standing seam (existing shed roof to also be

replaced with same)

Siding: Vintage woods heat modified southern yellow pine in color 101-

Double espresso (to match existing shed)

18" wainscot in recycled corrugated from main house roof to addition and also to base of exisiting shed in new location (to conceal new foundation)

Trim: to match siding

. .

o. Accessory building windows: Refer to GL4.53-4.63, 4.89;

GL	Staff Analysis	DRC Recommendation
4.53; 4.89 AB fenestration	There are two single windows on the north, east and west elevations. The south elevation has one window.	Support
	There are fewer windows than the primary building. The window to wall ratio for the proposed north elevation is 17.6%. This percentage is more relational to primary building. Staff would suggest reduction in the glazing for this elevation.	



4.54 Vertical emphasis	Windows are proposed as two over	Support
	two awnings with simulated divided	
	lights.	
4.56 Window material	Windows are noted as aluminum	Support
	clad, color confirmation needed.	
	Support.	
4.59 Trim	Wood trim 2"x4" (stained brown) is	Support
	noted. Support	

**p.** Accesory building doors: Refer to GL -4.64-4.66, 4.68-4.69 4.90;

GL	Staff Analysis	DRC Recommendation
4.66 Secondary Doors	There is a ½ light aluminum clad	Support
	person door on the north, color must	
	be confirmed. Support	
4.69, 4.90 Garage doors	There is a garage door proposed on	Support
	the south elevation and a smaller	
	garage door proposed on the west	
	elevation. Wood veneer was	
	referenced at the DRC meeting.	
	There were traditional barn door	
	details added to both doors.	

# q. Accessory building materials: Refer to GL 4.82, 4.89

## New garage:

Roof: weathering steel standing seam

Siding: Vintage woods heat modified southern yellow pine in color 101- Double espresso

(to match existing shed)

18" wainscot in recycled corrugated from main house roof

Trim: to match siding





This building proposes a weathered standing seam material for the roofing to match the adjacent building to the west.

Siding is proposed as a 6" vertical channel lapped siding in southern yellow pine (double espresso). There is an 18" foundation cover in recycled corrugated metal from the primary residence.

Trim is noted as 2"x4" wood (dark espresso brown). Fascia size and color must be confirmed. Corner boards are noted as 2"x4" (dark espresso brown).

There is a ½ light aluminum clad person door on the north, color must be confirmed. There is a garage door proposed on the south elevation and a smaller garage door proposed on the west elevation. Both are noted as aluminum doors and were noted to be clad with wood.



Windows are proposed as aluminum clad double hung with simulated divided lights, color confirmation needed.

GL	Staff Analysis	DRC Recommendation
4.82 Roofing	Standing seam is supported.	Support
	The rusted metal appearance has not been supported. Naturally weathered material is supported.	
4.89 c Simple design and details	The siding meets the intents of the GL. However, as stated above, the	Support
	material should be varied from the building to the west.	1/21 DRC: Members voiced that a small distinction would be good, but it should not be too different, as the nature of the
		buildings are simplicity. A slight differentiation has been provided.

#### III. DRC Action:

- Review the updated site plan specific to snow storage, parking, landscaping, hardscape.
- Make a recommendation to the full Board regarding architectural appropriateness, for both primary and existing accessory building.
- Make a recommendation to the full Board regarding the materials list for the proposed plans.
- Make a recommendation to the full Board regarding the new cold accessory building regarding architectural appropriateness.
- Make a recommendation to the full Board regarding materials list for the proposed plans.

#### IV: Overall DRC findings:

- Recommendation of support to the full Board regarding the addition to the primary building regarding mass/scale and form
- Recommendation of support to the full Board regarding the addition to the existing accessory building regarding mass/scale and form.
- Recommendation of support to the full Board regarding the new cold accessory building regarding mass/scale and form.

DRC Notes: 1/21/2025 TUESDAY DRC Roxana Alvarez Marti and Halley Anderson

1. (Liebl 226 Sopris); Earley overviewed that Anna Rhees and Jim Jose of SHM Architects submitted plans on behalf of the Liebl's for an addition to the existing contributing SFR at 226 Sopris Avenue within the R1C zone and to lift the existing historic accessory building and shift it to the north 5' to accommodate parking in the rear. Then, there is a proposal for a new cold AB on the east. There are some setbacks that need revisions and the applicant is aware of this. The AB and SFR have always been lumped together due to proximity and shifting the building closer will still have that condition. So, it is an accessory building but it is considered part of the primary building because there is less than 10'. So it doesn't meet the requirement for a heated building. There is a note that snow storage is not provided, but I missed the sheet with this inclusion. So, please disregard. There is an existing easement on the west and the adjacent owner has provided a letter of support for the addition onto the existing AB. Otherwise, zoning requirements have been met. There are a number of items needed to be included on the site plan, as outlined in the staff report. There is support for the addition. However a rendering of the southeast corner before and after would be helpful to ensure that the Board has context of what is proposed. Roof pitches are compliant. There is a proposal to switch the two pack of windows on the south to the east to accommodate a new French door on the south. Windows and doors for the primary building are supported.

The addition to the existing AB appears subordinate and a connector module wouldn't be needed. It steps in from the north and south and also steps down from the ridge. All historic materials must be kept on the existing historic building, including the windows. The new addition proposes materials to match, but it would seem that a change in materials would be more GL compliant to cleave the difference between old and new. There is a large amount of windows on the west that appears to conflict with window to wall GL. The windows/doors on the north and south comply, but do appear cramped within the addition. Discussion is encouraged to determine if this is dissimilar.

The new AB is set to the rear of the site and is simpler than the existing primary building, as the GL as for. The two gable modules mimic two small structures. Windows and doors appear compliant, as well as roof pitches. Again, materials are proposed to match the existing historic structure. GL suggest differing materials for this building to honor the original structure.

Rusted metal roofing has generally not be supported as a treatment in recent years. Naturally aged or reclaimed material is supported.

Lighting must be added to elevations to ensure compliance. Any fixtures that are not in compliance would need to be upgraded as part of this proposal.

Todd and Denise Liebl were present with Anna Rhees and Jim Jose. They referenced the sun room element on the west elevation of the AB. They asked if it was the horizontal or vertical nature or the size. They have provided a 3D model for the primary building southeast corner.

Site Plan: DRC in February will be a site visit. The setbacks have been fixed. Overall support from DRC.

Historic AB: members noted that the amount of fenestration is contemporary. Jose suggested reducing from four to three on the west. Anderson mentioned the GL relating to 2 to 1 ratio.

Siding would be removed from the west to help with replacement of siding in other areas that is in disrepair.

They asked if the material could be different with a finish, for instance with a lighter stain. Members said that the form helps to differentiate. They could support some contrast, but not too much.

New AB: Wood veneer was added to the garage door.

They will update elevations which were labeled incorrectly.

They removed the person door on the north.

They will add lighting.

It was encouraged to differ the material and add the foundation cover which also helps to show differentiation.

They removed the window on the south.

Overall support.

COLORADO HISTORICAL SOCIETY Office of Archaeology and Historic Preservation 1300 Broadway, Denver, Colorado 80203

#### HISTORIC BUILDING INVENTORY RECORD

	NOT FOR FIEL	D USE
Eligible	_	Nominated
Det. Not	Eligible _	Certified Rehab.
	Date	655

	Control of the Contro		and the second s	one depos
PROJECT NAME: Crested Butte Historic Buildings Survey (SHF No. 98-01-113)	COUNTY: Gunnison	CITY: Crested Butte	STATE ID NO.:	5GN3253
Julvey (Sil No. 98-01-113)			TEMPORARY NO.:	: 33021
ADDRESS: 226 SOPRIS AVE Crested Butte, CO 81224	OWNER: VERZUH	MARTIN		
ASSOCIATED BUILDINGS SURVEYED: X Yes No A. Shed	BOX 1 CRESTED	) BUTTE CO 81224		
	TOWNSHIP 14S	RANGE 86W	SECTION 3	SW 1/4 NE 1/4
BUILDING Current:	U.S.G.S. QUAD	NAME: Crested Bu	tte, Colo YEAR: 1961	X 7.5' 15'
NAME: Historic: Verzuh Residence	BLOCK: 33 ADDITION: Orig		OT(S): E 62.5'OF W7 YR. OF	75' 1-5 ADDITION: 1881
DISTRICT NAME: Crested Butte PHOTOGRAPHIC				
PHOTOGRAPHER: Sandra Cortner (Roll/Frame and Camera		3-15, S; 3-16, SE; 3-17, SW; 3-18, WNW; 38-22A, S		
LOCATION OF NEGATIVES: Town of Crested Butte	Direction)			
SKETCH MAP: See attached map; resource is indicated	with arrow.	DATE OF CONSTRU	CTION:	
EXTENT OF ALTERATIONS: X Minor Moderate Major		Estimate: Actual: 1883 Source: Gunn	ison County Assesso	or
Describe: Two-light window on upper story of facade.		USE: Present: Residence		
		Historic: Resi	dence	
		CONDITION:		· · · · · · · · · · · · · · · · · · ·
CONTINUED Yes	X No	Excellent X Fair		Good Deteriorating
STYLE: Vernacular Wood Frame (Foursquare)		MATERIALS: Wood		
ARCHITECTURAL DESCRIPTION: Two-story rectangular frame dwelling with hipped roof	with widely ov	erhanging	STORIES:	
eaves; rear gabled extensions; corrugated metal roofi have braces underneath. Concrete block chimney with		1	on east t roof FOOTAGE:	
slope. Concrete foundation. Walls clad with beadboa		-		
Upper story front has two square engaged pilasters at window on upper story with wood surround with sills w			ORIGINAL SITE X	aluina:
Full-width, shed roof porch with wood shingle roofing			MOVED  DATE(S) OF MOVE:  NATIONAL REGISTER ELIGIBILITY	
horizontal board balustrade; wood deck. Slightly off paneled and glazed door. 2/2-light double-hung sash		1		
surrounds flank door. East side has two 2/2-light wi side has two 2/2-light windows on upper story and one		- I		
and single 2/2-light window on lower. Two gabled pro			INDIVIDUAL:	
section has brick chimney and shed projection on east		two round	YES X	NO
arched lights on north and band of six-light windows	on east.		CONTRIBUTING TO DI	
₩ -				
		-	X YES  LOCAL LANDMARK DES	NO
				COMITON ( NO
CONTINUED? YES X NO		es x no	NAME: DATE:	Minocorporation
ADDITIONAL PAGES: YES X NO				ACCOUNTY.

ARCHITECT: Unknown  SOURCE:  SOURCE:  CONSTRUCTION HISTORY (Description, names, dates, etc., relating to major alterations to the original structure): The rear extensions appear on the 1890 Sanborn map, which also shows a wrap-around porch on the first rear extension on the east wall.
SOURCE:  SOURCE:  SOURCE:  THEME(S): Coal Mining, 1870-1952  CONSTRUCTION HISTORY (Description, names, dates, etc., relating to major alterations to the original structure): The rear extensions appear on the 1890 Sanborn map, which also shows a wrap-around porch on the first rear extension on
SOURCE:  SOURCE:  SOURCE:  SOURCE:  THEME(S): Coal Mining, 1870-1952  CONSTRUCTION HISTORY (Description, names, dates, etc., relating to major alterations to the original structure): The rear extensions appear on the 1890 Sanborn map, which also shows a wrap-around porch on the first rear extension on
THEME(S): Coal Mining, 1870-1952  CONSTRUCTION HISTORY (Description, names, dates, etc., relating to major alterations to the original structure): The rear extensions appear on the 1890 Sanborn map, which also shows a wrap-around porch on the first rear extension on
THEME(S): Coal Mining, 1870-1952  CONSTRUCTION HISTORY (Description, names, dates, etc., relating to major alterations to the original structure):  The rear extensions appear on the 1890 Sanborn map, which also shows a wrap-around porch on the first rear extension on
The rear extensions appear on the 1890 Sanborn map, which also shows a wrap-around porch on the first rear extension on
the east wall.
CONTINUED YES X NO
HISTORICAL BACKGROUND (DISCUSS IMPORTANT PERSONS AND EVENTS ASSOCIATED WITH THIS STRUCTURE): This home is associated with the Martin Verzuh family. Martin Verzuh came from Austria-Croatia to the United States. He
married Frances Spehar in 1897. She was also from Austria-Croatia and came to the U.S. in the late 1890s. Martin Verzuh
operated a saloon and opened a general mercantile in Crested Butte in 1905. The 1910 U.S. Census provides the following
information about the family: Martin Verzuh, aged 40, proprietor of general store; Fannie, wife, age 31; and children
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  ASSOCIATED WITH SIGNIFICANT PERSONS
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW): ARCHITECTURAL SIGNIFICANCE:
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEFLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION  X CONTRIBUTES TO AN HISTORIC DISTRICT
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  ASSOCIATED WITH SIGNIFICANT EVENTS OR PATTERNS
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION  X CONTRIBUTES TO AN HISTORIC DISTRICT  STATEMENT OF SIGNIFICANCE:  This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double-hung sash windows, and paneled
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. Ris career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION  X CONTRIBUTES TO AN HISTORIC DISTRICT  STATEMENT OF SIGNIFICANCE:  This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double-hung sash windows, and paneled and glazed doors. The house is associated with the Verzuh family, early residents of Crested Butte and operators of an
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION  X CONTRIBUTES TO AN HISTORIC DISTRICT  STATEMENT OF SIGNIFICANCE:  This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double-hung sash windows, and paneled
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. Ris career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION  X CONTRIBUTES TO AN HISTORIC DISTRICT  STATEMENT OF SIGNIFICANCE:  This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double-hung sash windows, and paneled and glazed doors. The house is associated with the Verzuh family, early residents of Crested Butte and operators of an
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. Ris career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  CONTINUED YES X NO  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION  X CONTRIBUTES TO AN HISTORIC DISTRICT  STATEMENT OF SIGNIFICANCE:  This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double-hung sash windows, and paneled and glazed doors. The house is associated with the Verzuh family, early residents of Crested Butte and operators of an
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. Ris career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION  X CONTRIBUTES TO AN HISTORIC DISTRICT  STATEMENT OF SIGNIFICANCE:  This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double-hung sash windows, and paneled and glazed doors. The house is associated with the Verzuh family, early residents of Crested Butte and operators of an
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clerk at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. Ris career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEPLY JUSTIFY BELOW):  ARCHITECTURAL SIGNIFICANCE:  REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS THE WORK OF A MASTER  POSSESSES HIGH ARTISTIC VALUES  X REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION  X CONTRIBUTES TO AN HISTORIC DISTRICT  STATEMENT OF SIGNIFICANCE:  This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double-hung sash windows, and paneled and glazed doors. The house is associated with the Verzuh family, early residents of Crested Butte and operators of an
Fannie, Mary, Mike, Rose, Rudolph, Julia, Emma, and Martin. Martin Verzuh, Jr., was educated in Crested Butte schools during 1924-1936. He worked as a post office clerk for many years beginning in 1947, as a clork at the Martin Verzuh store for 8 years, and as co-manager of the Princess Theater for 12 years. Rudolph Verzuh was educated in Crested Butte. His career included work as a clerk, butcher, and manager of the Martin Verzuh store (1924-1935); postmaster of Crested Butte (1935-1972); owner-operator of the Princess Theater (1940-1950); and real estate agent (1954-1973).  SIGNIFICANCE (CHECK APPROPRIATE CATEGORIES AND BRIEFLY JUSTIFY BELOW): ARCHITECTURAL SIGNIFICANCE: REPRESENTS THE WORK OF A MASTER POSSESSES HIGH ARTISTIC VALUES ASSOCIATED WITH SIGNIFICANT PERSONS REPRESENTS A TYPE, PERIOD, OR METHOD OF CONSTRUCTION X CONTRIBUTES TO AN HISTORIC DISTRICT  STATEMENT OF SIGNIFICANCE: This house is representative of the dwellings erected in Crested Butte during the late nineteenth century. Notable features include the hipped roof, frame construction, pilasters at the second story, double-hung sash windows, and paneled and glazed doors. The house is associated with the Verzuh family, early residents of Crested Butte and operators of an early mercantile business.

SURVEYED BY: R.L. Simmons/T.H. Simmons

AFFILIATION: Front Range Research Associates, Inc.


Crested Butte Melting Pot (Crested Butte: Myrtle & Michele Veltri, 1986), 47; Crested Butte Oldtimers Meeting, 25 August

1998; Sandra Cortner Photographic Collection, Photograph of 226 Sopris, 1995.


YES DATE: March 1999


Х

CONTINUED

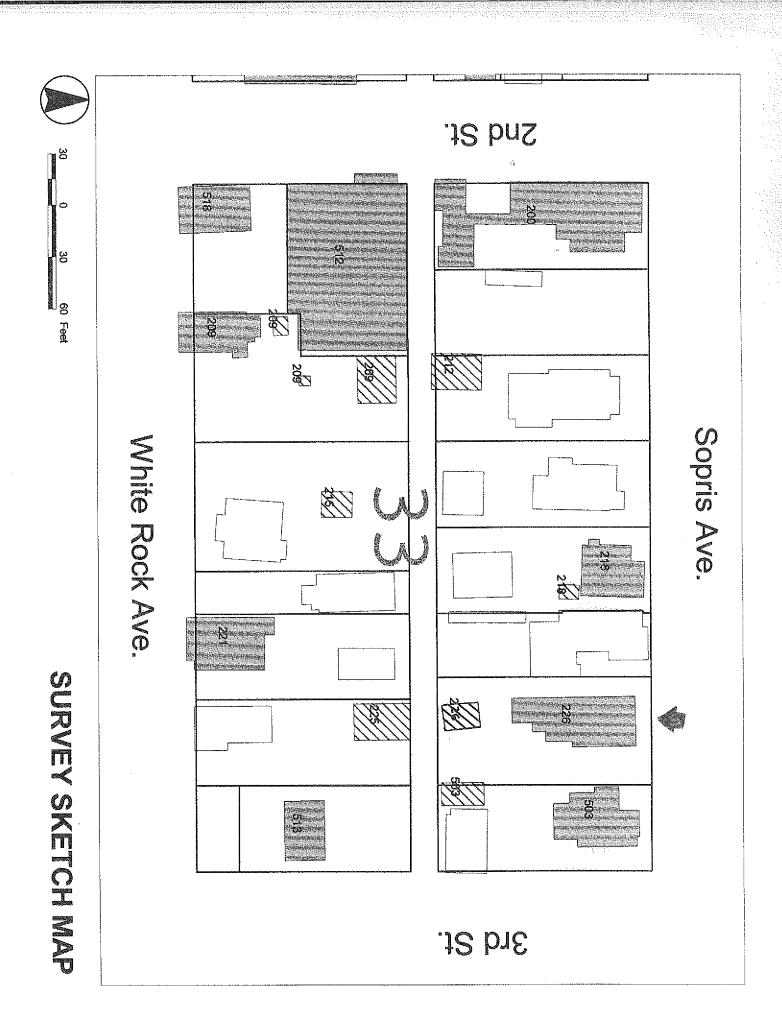



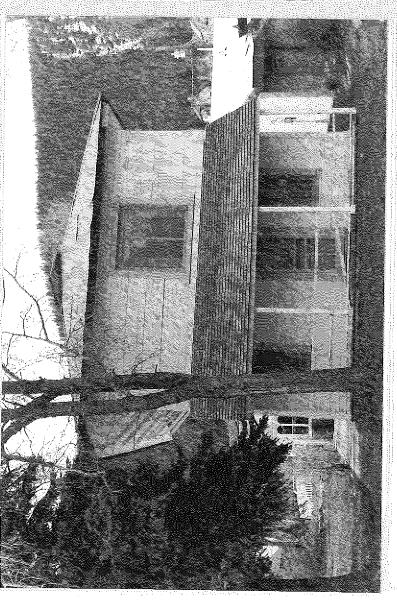

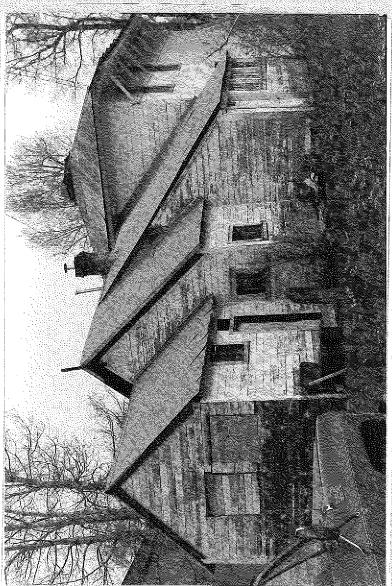

State ID Number: 56N3253 SHF Grant No.: 98-01-113


Address: 226 SOPRIS AVE City: Crested Butte Co


County: Gunnison Photographer: Sandra Cortner

Rell Number:

Camera Direction: S Date: May 1998 Frame Number: 15

Location of Negatives: Town of Crested Butte

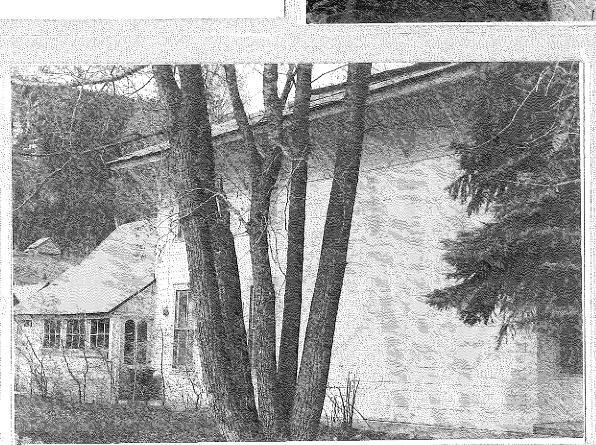

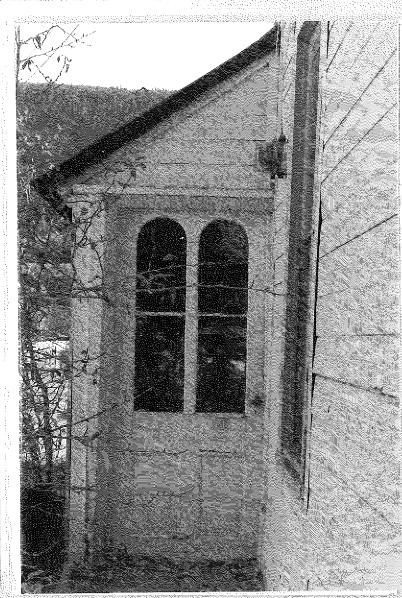


COLORADO HISTORICAL SOCIETY Office of Archaeology and Historic Preservation 1300 Broadway, Denver, Colorado 80203

#### HISTORIC BUILDING INVENTORY RECORD -- OUTBUILDING

		NOT	FOR	FIELD	USE		
 Eligi	.ble				Non	inated	
 Det.	Not	Elig	jible	<u> </u>	Cer	tified	Rehab,
		Da	te		7	80'	


	an Canada mari na tao an mari ao ao ami ao	manus (C) (may) (may) magamatana (may) (may 1 fata) (matana magamatana (magamatana magamatana magamatan		
PROJECT NAME: Crested Butte Historic Buildings	COUNTY:	CITY:	STATE ID NO.: 5GN3254	
Survey (SHF No. 98-01-113)	Gunnison	Crested Butte	TEMPORARY NO.: 33021	
	MOIDIOILE F.O.			
ADDRESS: 226 SOPRIS AVE Crested Butte, CO 81224	TOWNSHIP 14S	RANGE 86W SEC	TION 3 SW QTR OF THE NE QTR	
ASSOCIATED State ID No.:	USGS QUAD. Cre	sted Butte, Colo	QUAD, YEAR: 1961	
PRIMARY	BLOCK: 33		S): E 62.5'OF W75' 1-5	
BUILDING: Type of Building:	ADDITION: Orig	inal rown	YR. OF ADDITION: 1881	
DISTRICT NAME: Crested Butte	PHOTOGRAPHIC REFERENCES: 3	-19, SW; 3-20, NW		
	(Roll/Frame			
DATE OF CONSTRUCTION: Estimate: 1890s	Camera Dir,}			
Actual: Source: Sanborn Map, 1898	PHOTOGRAPHER:	Sandra Cortner		
-	LOCATION OF NE	GATIVES; Town of Cr	ested Butte	
USE: Present: Shed	ORIGINAL SITE	X MOVED	LOCAL LANDMARK DESIGNATION: No	
Historic: Shed	DATE OF MOVE:		NAME: DATE:	
ARCHITECTURAL DESCRIPTION: One-story, rectangular (12' X 18') frame shed with for	ront gable	EXTENT OF ALTERATI X Minor	ONS: Moderate Major	
roof and overhanging eaves; metal roofing. Walls cla	ad with	Describe:	th plywood; wall patched with	
vertical board siding. On north are double hinged ve	ertical	horizontal boards		
board doors. Windows covered with plywood.				
		STATEMENT OF SIGNI	FICANCE:	
		STATEMENT OF SIGNIFICANCE; This shed is representative of the variety of		
		-	ed in Crested Butte. Representative	
		features include the gable roof, frame construction,		
		and vertical board	siding.	
			•	
HISTORICAL BACKGROUND:	<b>i</b>	gT	GNIFICANCE CATEGORIES:	
This shed is associated with the residence at 226 Son	pris which was t	he home of		
the Martin Verzuh family.			Represents the work of a master Possesses high artistic values	
		i i	Represents a type, period, or	
			method of construction Associated with signif, persons	
			Associated with signif. events	
		x	or patterns Contributes to an historic dist.	
		MA	TIONAL REGISTER ELIGIBILITY	
黎				
		IN	DIVIDUALLY ELIGIBLE: YES X NO	
		co	NTRIBUTING TO DISTRICT: X YES NO	
		<u>_</u>	-	
SURVEYED BY: R.L. Simmons/T.H. Simmons AFFILIA	FION: Front Rang	e Research Associat	es, Inc. DATE: March 1999	

White Rock Ave.

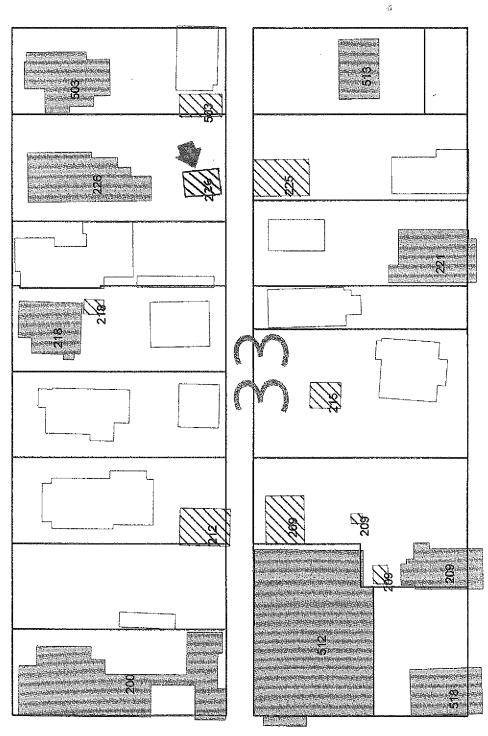

3rd St.


2nd St.

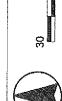


8

39

0

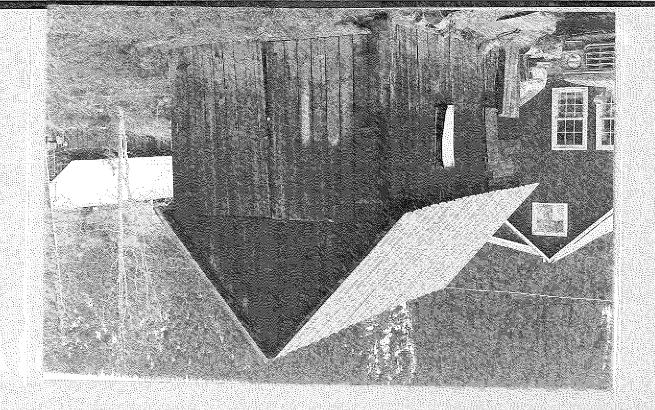

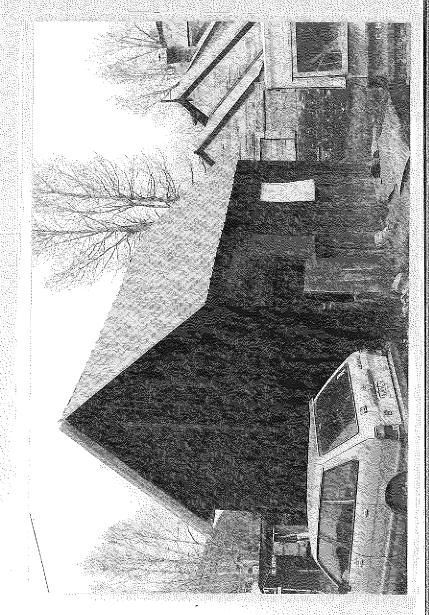

) 226 SOPKIS NR 708

State ID Number: SGN3254 SHF Grant No.: 98-01-113 Address: 226 SOPRIS AVE City: Grested Butte County: Gunnison

Photographer: Sandra Cortner

Roll Number: 3 Frame Number: 20 Camera Direction: NW Date: May 1998

Location of Negatives: Town of Crested Butte

3/19 226 SOPRIS 8W 708

State ID Number: 5GN3254 3HF Grant No.: 98~01-113

Address: 226 SOPRIS AVE

City: Crested Butte County: Gunnison

Photographer: Sandra Cortner

Roll Number: 3 Frame Number: 19 Camera Direction: SW Date: May 1998

Location of Negatives: Town of Crested Butte

Todd and Denise Liebi 226 Sopris Ave. Crested Butte, CO 81224

Kyleena Falzone PO Box 2471 Crested Butte, CO 81224

Kyleena,

As we have discussed with you in prior texts, we are wanting to add on to the shed on our property (226 Sopris) so that we can convert the shed into an art studio for Denise. The addition to the shed would extend the shed's west wall to a maximum of 4.5' onto the existing 12' utility easement. That easement being the one set out in the Easement Agreement between us dated July 30, 2024 and recorded as document No. 697562 in Gunnison County.

In conversations with the Town about the addition to the shed, they would like for you to confirm that you have no objection too the addition as far as addition would be on the utility easement area.

The existing utilities serving your house located on the easement area are located west of the proposed addition so there would be no interference with those utility lines.

With your signature below you would be confirming that you have no objection to the shed addition as described.

We greatly appreciate your help.

12/16/2024

Kyleena Falzone

# ACCESSORY STRUCTURE DESCRIPTION OF MATERIALS TO BE USED

NAME Lieb/ Residence
West 75 ft. of Lots 1-5 except  LEGAL the West 12.5 ft. of Block 33 ZONE R1C
ADDRESS 226 Sopris Ave., Crested Buttle CO 81224
TYPE OF STRUCTURE
Accessory Building, heated and/or plumbed  Accessory Building, cold
Accessory Dwelling Addition Historic Rehab
Other
ROOFING TYPE
Shake Shingle Pro Panel style Galvanized, Corrugated Metal
Milled Shingle Standing Seam 5-V Crimp  in weathering stee
Other
EXTERIOR FINISH
Siding TYPE SIZE LOCATION COLOR
Horizontal
Vertical 6" shed addition, garage walls southern yellow pine.  Vertical 6" shed addition, garage walls southern yellow pine.  Other Wainocot in recycled corrugated from main house roof (18")
Other Wainscot in recycled corrugated from main house mof (18")
Stucco_
Trim to match siding

X Fascia to match siding	
Corner Boards_	
MATERIAL STYLE  garage door - Carriage style, we  X Primary door  Studio french doors - SDL, wood,  X Secondary door garage man door - 1/2 life we  ceal deace painted red  Small yard garage door - stained	
WINDOWS	V
Tyne:  Casement Simulated, divided lite  Casement, egress True, divided lite (historic)  Awning  Fixed  Other  Simulated, divided lite  Aluminum clad, wood lite (historic)  Other	Glazing: Low E Heat mirror Tempered Standard Other
Describe locations if a mix is used Aluminum clad wood to ruse true divided wood windows from existing a new East elevation of main residence	to garage + shed (SDL)
Other Exterior Features (i.e. railings, chimneys, posts	s, etc.)
I agree to submit changes from the list above to the building inspechairman for approval prior to implementation of the change.	
SIGNATURE OF OWNER / REPRESENTATIVE	(SHM Architects)
DATE 12 - 19 - 24	

door

# PRIMARY STRUCTURE DESCRIPTION OF MATERIALS TO BE USED

NAME LIEB/ RIST	dence	
West 75 ft. of LEGAL the west 12.5 ft	flots 1-5 except to of block 33 ZONE	R1C
ADDRESS 226 Sopri	's Ave., Crested Butte	, CO 81224
TYPE OF STRUCTURE		
Single Family	Accessory Building	Commercial
Multi Family	Addition	Historic Rehab
Accessory dwelling	Other	
ROOFING TYPE  Shake Shingle  Milled Shingle  Other  EXTERIOR	1 1 1 1	weathering stalvanized, Corrugated Metal V Crimp
FINISH  Siding  TYPE SIZE	LOCATION	COLOR
Horizontal to mate	h wist addition	painted to match exist.
Vertical		
Other	· · · · · · · · · · · · · · · · · · ·	
Stucco		
	sting, painted to match	existing

X Fascia <u>√o mado</u> ∠ Corner Boards →			match existing
DOORS	MATERIAL	STYLE	FINISH
Primary door			
∑Secondary door//	wood pati's do ites	or w/ simul	ated divided
WINDOWS			
Time: Casement	Style:	Material:	Glazing: Low E
Casement, egress	divided lite	Aluminum	Heat mirror
Double hung	True, divided lite (historic)	clad, wood	Tempered
Awning	Decorative mullions	Other	Standard
Fixed	Other		Other
Slide-by	<del></del>	10. < 1	
Describe locations if a m	nix is used <u>no neu</u>	y from o windows	wation on Eele
Other Exterior Feat	tures (i.e. railings, c	himneys, posts,	etc.) <i>N/A</i>
	s from the list above to rior to implementation o		
SIGNATURE OF OWN	ER / REPRESENTATI	VE KMA (TUB	SHM Architect
DATE 12 - 19 - 202	4	, ,	

#### **Liebl Shed**

#### Narrative:

We propose to shift the existing shed to the east temporarily, install new foundations 5 ft north of the existing shed location, and shift the existing shed onto the new foundations with a small addition to the west side of the building. The existing shed is an unheated outbuilding with no power or plumbing. The shed in its new location will have an insulated envelope added to the interior and will have heating, plumbing, and electricity. It will be used as an art studio. See condition assessment report and relocation plan below.

#### **Condition Assessment report:**

#### **Building Envelope:**

The existing shed requires new foundations. The structure of the roof and walls are in reasonably good condition. A new foundation, floor structure, and new bottom plates will be installed as part of the relocation. The existing framing will be assessed by a structural engineer and any reinforcement required will not be visible from the exterior.

#### Mechanical systems:

The existing shed has no electrical, plumbing or heating/ventilation systems.


#### **Building Components:**

The interior of the existing shed has horizontal planks covering the studs, it has exposed rafters, no insulation, and vertical board siding to the exterior that allows daylight through. As part of the relocation, a weathertight insulated envelope is proposed to be added to the interior, maintaining the visual character of the exterior.

#### Existing interior wall lining:



#### Existing exposed roof framing:

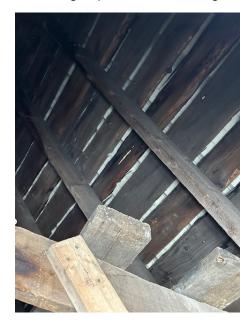

The existing building has two windows on the east elevation that were broken at some point and covered with corrugated metal. We propose these windows be replaced and the corrugated metal be removed.

Existing windows as seen from the interior:





#### Evidence of disease causing organisms:

There is no visible evidence of disease-causing organisms or hazardous materials.

#### Regulatory compliance:

The existing building is compliant with height and setbacks for its zoning, but alley parking would be improved if it was moved 5 ft. to the north.

#### Relocation plan:

The existing shed will be lifted onto steel "I" beams by a historic relocation company and slid approximately 15 ft. to the East on site while a new foundation is installed. If the floor framing is found not to be in adequate condition to lift the building by, beams to lift by will be attached to the wall framing with lag bolts. Once the new foundations are ready, the shed will be slid back west onto the new foundations.

# Liebl Residence


Materials Storyboard

11/25/2024





Proposed Alley view

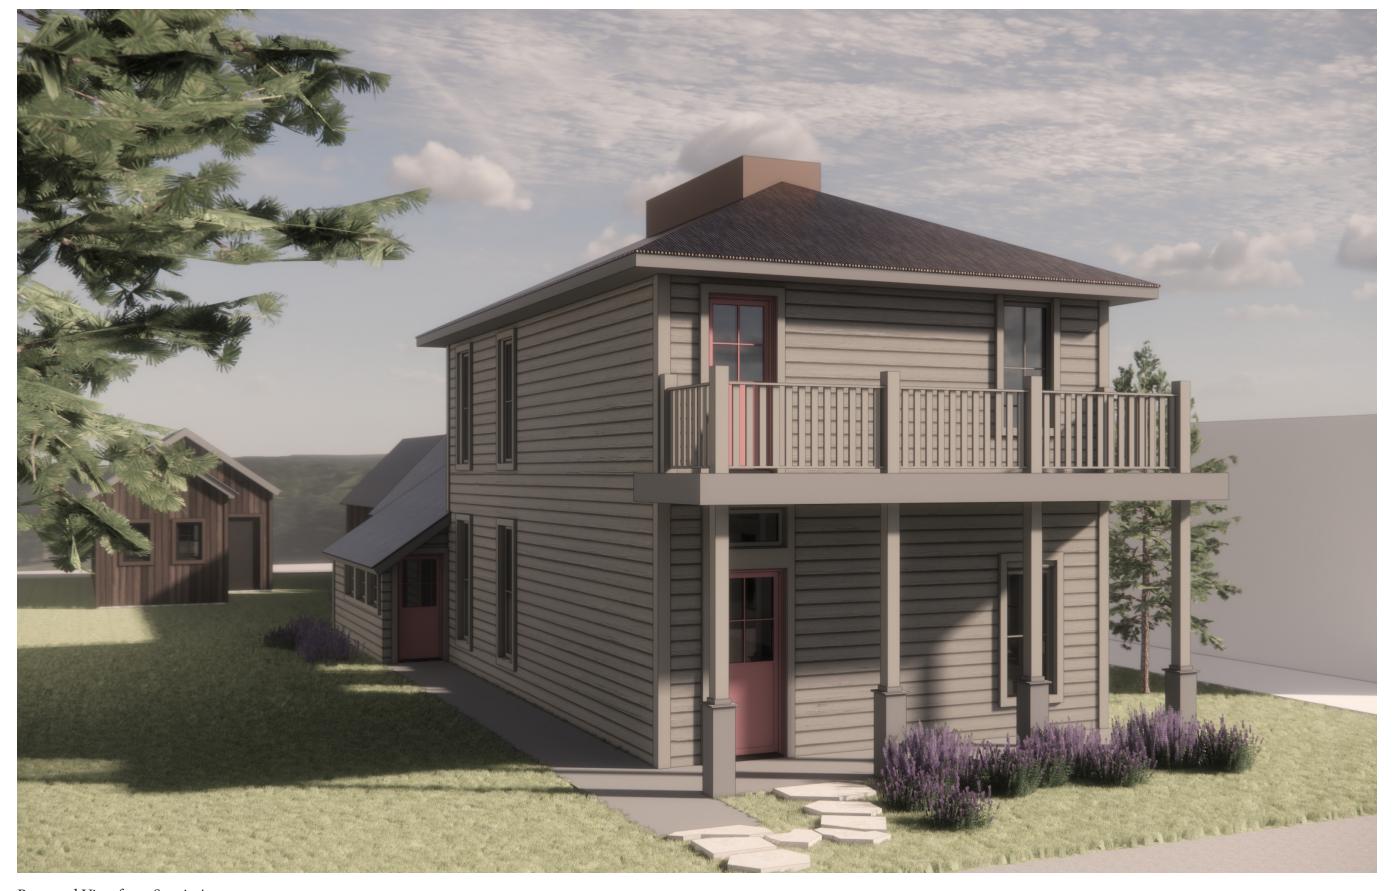

Proposed View from Sopris Ave.



## Liebl Remodel materials list:

## Addition to existing house:

Roof: Corrugated metal to match existing

Siding: Painted wood clapboards, dimensions and color to match existing

Trim: Painted wood trim, dimensions and color to match existing

Foundation coating: painted stucco to match existing

# Addition to existing shed:

Roof: weathering steel standing seam (existing shed roof to also be

replaced with same)

Siding: Vintage woods heat modified southern yellow pine in color 101-

Double espresso (to match existing shed)

18" wainscot in recycled corrugated from main house roof to addition and also to base of exisiting shed in new location (to conceal new foundation)

Trim: to match siding

# New garage:

Roof: weathering steel standing seam

Siding: Vintage woods heat modified southern yellow pine in color 101- Double espresso

(to match existing shed)

18" wainscot in recycled corrugated from main house roof

Trim: to match siding



foundation coating in painted stucco to match existing



painted wood clapboards dimensions and color to match existing

painted wood trim, dimensions and color to match existing house

corrugated roofing in weathering steel to match existing





Proposed weathering steel standing seam



Proposed weathering steel standing seam





Proposed Vintage Woods heat modified southern yellow pine in color 101 - Double Espresso



